

Lancaster Frappe

Silverline Cabinetry by Medallion



OVERLAY

Full 1¼"

DOOR STYLE

Lancaster

DOOR CONSTRUCTION

Mortise and Tenon

DRAWER FRONT

5-Piece


FINISH

Painted Frappe

ADDITIONAL FEATURES

- Solid Wood Dovetail Drawers
- Soft Close Doors & Drawers
- ¾" Shelves
- Limited Lifetime Warranty
- Made in Culver, IN

Cabinet Specifications

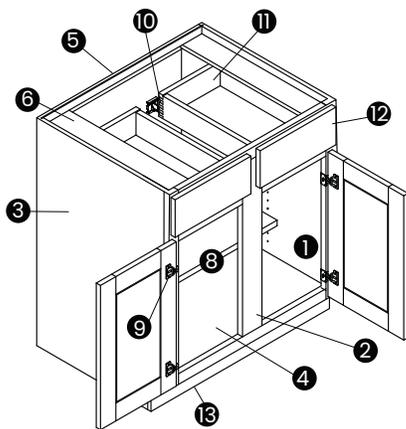

1 Interior

Natural Maple Laminate

2 Face Frame

¾" thick solid wood; glued, clamped, and screwed.

3 End Panels

1/2" thick laminated furniture board. Exterior is non matching wood grain laminate

4 Top and Floor

1/2" thick light maple wood grain laminated furniture board.

5 Back

1/8" thick light maple wood grain laminated hardboard. Grain direction is horizontal on walls, bases, and vanities, vertical on tall cabinets; however, grain direction of finished interior cabinets is vaertical.

6 I-Beam (base & vanity cabinets)

1/2" thick furniture board I-Beams are dadoed into face frame end panel and back panel, providing extra structural support.

7 Hanger Rail

1/2" thick furniture board hanger rails are pocket screwed to backs of cabinets for enhanced structural integrity.

8 Shelves ¾" Thick

Standard wall, full-height door base, and peninsula base cabinets receive full-depth shelving. Standard base door/ drawer cabinets receive 2/3 depth shelves.

9 Hinges

Six-way adjustable concealed. Quiet close hinges open a maximum of 105°. Left door shown in drawing are depicted open beyond actual allowance to show cabinet interior details.

10 Drawer Guides

Quiet close guide system consists of ball bearing mechanics and full extension hardware for full access. Guides are installed to bottom of drawer box or roll-out tray in an undermount concealed fashion and include a 'positive' close feature; when closing, guide system prevents drawer or roll-out tray from 'bouncing' back open. An additional mechanism controls closure in a smooth, uniform manner - it will not slam. This quiet close operation takes affect approx. 2" from final closed position. An easy release mechanism provides quick removal of drawer/roll-out tray. This guide system has a 75lb. weight capacity.

11 Drawer Box Construction

Four-sided construction featuring dovetail joints. Constructed with 5/8" thick hardwood sides and 1/4" thick plywood captured bottom. Clear coat applied. Color variety & wood character is allowed in hardwood.

12 Drawer Fronts

Drawer fronts are adjustable 1/8" vertically. Adjustments should be made prior to installation of decorative hardware.

13 Toe Kick

Sub toe kick is 4-1/2" high x 3-3/4" deep x 1/2" thick furniture board and does not match finish of cabinet.

Customer Signature (approval) _____ Printed Name _____ Date _____

Lancaster Frappe
Product Information Page

Silverline Cabinetry by Medallion

I agree to take delivery within 14 days of order placement. **Once I have received the cabinets, I agree to inspect for damage within 7 days.** I understand that neither Schillings nor Medallion will be held responsible for damage complaints beyond this time frame.

Warranty information

Medallion cabinets are certified by the Kitchen Cabinet Manufacturers Association (KCMA). This assures you that Medallion cabinets comply with the rigorous standards set by the American National Standards Institute (ANSI). Medallion warrants its cabinetry to be free of defects in material and/or workmanship under normal residential usage to the original purchaser for as long as they own their home. These warranties are only applicable to product used in residential applications within the United States & Canada and are not transferable to subsequent owners.

Silverline cabinetry comes complete with a Limited Lifetime Warranty. More information and specifications are defined on the Medallion website or upon request from vendor.

I am purchasing Medallion **Lancaster** door style with **Frappe** painted finish. Joint fracturing is common with painted wood cabinets. Fracturing is caused by changes in humidity levels within the home caused by varying weather conditions. This expansion and contraction may cause some visible cracks in the painted finish, particularly in the joint areas. Also, there may be a slight color shift due to continued exposure to natural and artificial light sources over time. We mention these characteristics because neither Schillings nor Medallion can be responsible for these conditions.

Schillings does not provide installation on cabinetry. Final adjustments to the doors and drawers are necessary and are the responsibility of the installer or the homeowner. If there is a problem that requires a replacement order, Schillings will do what we can to get the replacement product order rushed as fast as possible. However, Schillings cannot guarantee lead times and cannot offer monetary compensation or discounts for any delays. All single door cabinets come hinged **LEFT**. (Reversing hinging, as needed, is the installer's responsibility.)

Also, please be advised that additional labor costs can be incurred by adding materials that are labor intensive to install (ex: handles, moldings, roll out trays, etc).

These items are on closeout and are while supplies last. To ensure your order is complete, Schillings will pull the item(s) from inventory. No changes or cancellations can be made to your order. Closeout items are not returnable or refundable.

Customer Signature (approval) _____

Printed Name _____

Deposit Ticket _____

Today's Date _____

Last Revised 09/16/22